

PRIORITY

18 MAY 76 02 48Z

Army

Hold till 11:00 AM
14

AAUZEXM RULNNAQ2277 1398238-UUUU--RUMMDTA;
NR UUUUU
R 180230Z MAY 76 ZEX
MARNG OPERATING ACTIVITY CENTER EDGEWOOD ARSENAL MD//OAG-AVN-L//
O AIG 7481
TO RUEFHQA/CNGB WASHDC//NGB-ARL-A//
I 171920Z MAY 76
MCDRAVSCOM STL MO//DRSAV-FBU//

UNCLAS
1. REPEAT HAS NOT BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES;
2. ADDRESSES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL SUBORDINATE UNITS ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED;
3. THE RETRANSMITTAL SHALL REFERENCE THIS MESSAGE;
SUBJECT CLN MAINTENANCE ADVISORY MESSAGE CONCERNING ALL UH-1 SERIES
TAIL ROTOR HUB ASSEMBLIES (UH-1-76-10)
1. TB 55-1520-206-20-24 DATED 25 NOV 75
2. REF A IS SUPERSEDED BY THE INFORMATION PROVIDED IN THIS MESSAGE;
3. PURPOSE OF MESSAGE CLN TO PROVIDE ADVANCED INFORMATION CONCERNING

GE 2 RULNNAQ2277 UNCLAS
1. CHANGE TO THE OVERHAUL AND RETIREMENT SECTION OF THE UH-1 SERIES ORGANIZATIONAL MAINTENANCE MANUALS WHICH AFFECT RETIREMENT INTERVALS FOR THE TAIL ROTOR HUB, YOKE, AND GRIP ASSEMBLIES;
2. INFORMATION CLN THE FOLLOWING REVISION TO THE OVERHAUL AND RETIREMENT SCHEDULE, CHAPTER 3, OF TM 55-1520-210-20, TM 55-1520-1920-219-20 AND TM 55-1520-220-10 WILL BE INCLUDED IN FORTHCOMING MANUAL CHANGES CLN

AREA	RETIREMENT INTERVAL (HOURS)	ITEM	P/N
6	1700	HUB ASSY, TAIL ROTOR	284-011-881-5
6	1500	HUB ASSY, TAIL ROTOR	284-011-881-9
6	1500	HUB ASSY, TAIL ROTOR	284-011-881-17
6	500	GRIP ASSY	284-011-728-1
6	500	GRIP ASSY	284-011-728-19
6	1800	YOKE ASSY	284-011-722-1
6	1500	YOKE ASSY	284-011-722-5

4. TO MINIMIZE SUPPLY AND/OR MAINTENANCE IMPACT, GRIPS EXCEEDING 500 HOURS TSN SHOULD BE REPLACED DURING THE NEXT PERIODIC INSPECTION;
5. ADDITIONALLY, TB 55-1520-327-25 WILL BE UPDATED TO DELETE THE REQUIREMENT FOR A SEPARATE HUB ASSEMBLY DA FORM 2408-16; REQUIRING INSTEAD THAT THE HUB ASSEMBLY, THE YOKE AND THE GRIP ASSEMBLIES BE ENTERED ON THE AIRCRAFT DA FORM 2408-16, DA FORM 2410 WILL STILL BE REQUIRED FOR EACH OF THESE ITEMS
BT
#2277

145