



Ogle Angle Brackets

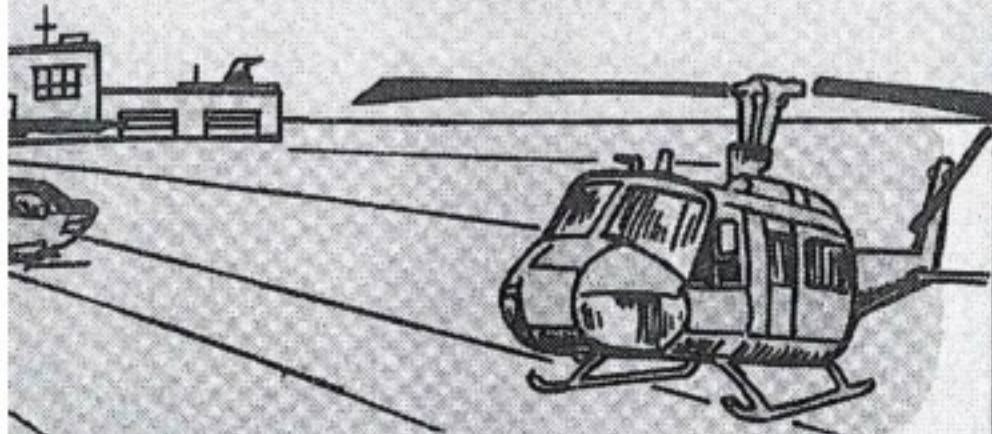

Focus on the Huey tail rotor servo, mechs, during Phase Maintenance. Some cases of elongated bolt holes in the angle brackets have cropped up.

Worn brackets, PN 205-076-230-1 and PN 205-076-118-1 listed in Fig 368, TM 55-1520-210-23P, should be replaced, and an EIR submitted to TSARCOM.

There is no stock number for a

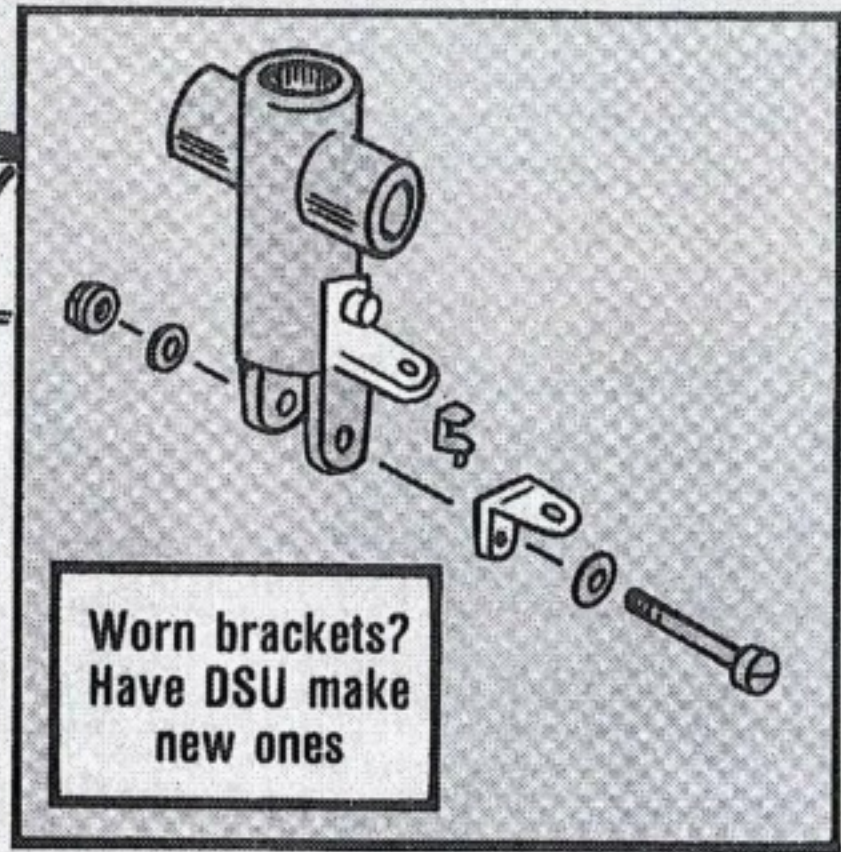

replacement bracket. However, your sheetmetal shop can make it by following the details in Figs D-215 and D-216 of TM 55-1520-210-23.