

25 AUG 78 13 24z

PAUZEKX RULNNA03571 2371744-UUUU-RUKMDTA,

ZNR UUUUU

P 251735Z AUG 78 ZEX

FM ARNG-DAC EDGEWOOD MD //NGB-AVN-L//

TO AIG 7401

INFO RUCLAKK/AASF GA ALBANY GA

RUVRBNA/AASF M2 TN MOGEE TYSON AFB TN

RUBAUSA/ONGB WASH DC //NGB-ARL-A//

P R 251400Z AUG 78

FM CDRTSARCOM STL MO //DRSTS-NEU//

TO AIG 8861

INFO AIG 9204

RUKTABA/CDR USABPA FT WORTH TX //DAVBZ/DAVRE-O//

RUCLEUA/CDR USAAVNO FT RUCKER AL //ATZR-DI//

BT

UNCLAS

NOTE CLN THIS IS A MAINTENANCE ADVISORY MESSAGE AND HAS NOT, REPEAT HAS NOT, BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES, ADDRESSEES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL SUBORDINATE UNITS, ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED,

ARMY

UH-1-78-10  
Hyd. hose failure  
from ID tag

PAGE 2 RULNNA03571 UNCLAS

SUBJECT CLN MAINTENANCE ADVISORY MESSAGE FOR ALL UH-1/AH-1 SERIES AIRCRAFT, (UH-1-78-10/AH-1-78-10),

1, PURPOSE OF MESSAGE CLN RECENTLY A HYDRAULIC HOSE ASSEMBLY FAILURE WAS CAUSED BY CHAFING OF A STAINLESS STEEL IDENTIFICATION TAG ON THE METAL BRADING, ALL STAINLESS STEEL I.D. TAGS WILL BE REMOVED,

2, PARTICULAR ATTENTION SHOULD BE DIRECTED TO ALL THE FLEXIBLE PRESSURE AND RETURN HYDRAULIC HOSE ASSEMBLIES, THE HOSE ASSEMBLIES HAVE METAL BRADING AND MAY HAVE THE STAINLESS STEEL I.D. TAGS ATTACHED,

3, DURING THE NEXT SCHEDULED AIRCRAFT INSPECTION, INSPECT HOSE ASSEMBLIES FOR STAINLESS STEEL I.D. TAGS, REMOVE TAGS, THOROUGHLY INSPECT THE METAL BRADING FOR ANY SIGN OF CHAFING OR WEAR, USUALLY THE BRADING WILL HAVE FLAT WORN SHINY SURFACES ON THE WIRE STRANDS, IF ANY WEAR IS FOUND, REPLACE THE HOSE ASSEMBLY, REPLACE STAINLESS STEEL I.D. TAGS WITH ALUMINUM TAGS IAN 18750-125 CHANGE 2 OR TM55-1500-204-25/1 PAGE 7-44A

4, IF ADDITIONAL INFORMATION OR CLARIFICATION OF THIS MESSAGE IS REQUIRED, PLEASE CONTACT MR, DICK MOOY, TSARCOM

PAGE 3 RULNNA03571 UNCLAS

23