WESTERN UNION C.R.C. MCLB DRAWER 38 ALBANY GA 31704 21AM



1-005318A233 08/21/91 ICS DODCRSB ABN BESC 01066 DOD CRC ALBANY GA 211904Z AUG 91/233

USDA FOREST SVC AVIATION FIRE MGT 3905 VISTA AVE BOISE ID 83705

utl-1-91- ASAM-15

1 R RUCIFRD5424 2331824 DA-BDCVBA R 211710Z AUG 91 ZEX FM CDRAVSCOM ST LOUIS MO //AMSAV-XSOF// TO RUCLRFA/USDA FOREST SERVICE AVIATION FIRE MGMT //3905 VISTA AVE BOISE ID 83705// DA-BDCVBA UNCLAS

PAGE 02 RUCIFRD5424 UNCLAS

SUBJECT - AVIATION SAFETY ACTION MESSAGE, INFORMATIONAL, RCS CSGLD-1860(R1), ALL UH-1 SERIFS AIRCRAFT, LOOSE FM ANTENNA COUPLER SCREWS, (UH-1-91-ASAM-15)

NOTE - THIS IS AN AVIATION SAFETY ACTION MESSAGE AND HAS NOT BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES. ADDRESSEES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL SUBORDINATE UNITS, ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED. THE RETRANSMITTAL SHALL REFERENCE THE MESSAGE.

- 1. PRIORITY CLASSIFICATION N/A.
- 2. TASK/INSPECTION SUSPENSE DATE N/A.
- 3. REPORTING COMPLIANCE SUSPENSE DATE N/A.
- 4. SUMMARY OF PROBLEM -
- A. A RECENT UH-1 CLASS A MISHAP WAS A RESULT OF THE NUMBER 1 FM ANTENNA DEPARTING ITS MOUNT ON THE TAIL FIN AND STRIKING THE TAIL ROTOR. THE ANTENNA DEPARTED THE AIRCRAFT DUE TO THREE OF THE FOUR MOUNTING SCREWS BACKING OUT AND THE FOURTH SCREW FAILING FROM OVERSTRESS. THE SCREWS (TM 11-5821-244-34P, FIGURE 44, ITEM 19) HOLD THE ANTENNA AND PLATE ASSEMBLY (ITEM 13) TO THE COVER (ITEM 18). THE SCREWS (ITEM 19) ARE NOT VISIBLE WITHOUT REMOVING THE COVER (ITEM 18) IAW TM 11-5821-244-34. PAGE 03 RUCIFRD5424 UNCLAS
- B. THE U.S. ARMY COMMUNICATIONS AND ELECTRONICS COMMAND (CECOM) HAS BEEN REQUESTED TO CHANGE TM 11-5821-244-34 TO INCLUDE THE USE OF LOCTITE WHEN INSTALLING THESE SCREWS. IN THE CURRENT CONFIGURATION, THERE IS NO LOCKING FEATURE ON THESE SCREWS. IN ADDITION, CECOM HAS BEEN REQUESTED TO INCLUDE AN INSPECTION OF THESE SCREWS FOR LOSS OF TORQUE WHENEVER THE SCREWS ARE ACCESSIBLE.
- C. UNTIL THE ABOVE MANUAL CHANGES ARE COMPLETED, UNITS ARE ENCOURAGED TO IMPLEMENT THE CHANGES AS THEY DETERMINE NECESSARY. SCREWS FOUND LOOSE SHOULD BE REINSTALLED USING LOCTITE.
- D. THE PURPOSE OF THIS MESSAGE IS TO INFORM UH-1 USERS OF THE CAUSE OF THE CLASS A MISHAP AND THE CORRECTIVE ACTIONS BEING TAKEN

To reply by Mailgram Message, see reverse side for Western Union's toll-free numbers.



TO PREVENT THE PROBLEM FROM RECURRING.

- ▶ 5. END ITEMS AFFECTED ALL UH-1 SERIES AIRCRAFT.
 - 6. ASSEMBLY COMPONENTS AFFECTED FM ANTENNA AND PLATE ASSEMBLY, P/N SMC381441, NSN 5821-00-089-8205.
 - 7. PARTS AFFECTED RETAINING SCREWS, P/N MS51959-29, NSN 5305-00-727-8832.
 - 8. INSPECTION PROCEDURES N/A.
 - 9. CORRECTION PROCEDURES N/A.
 - 10. SUPPLY/PARTS AND DISPOSITION N/A.
- PAGE 04 RUCIFRD5424 UNCLAS
 - 11. SPECIAL TOOLS, JIGS AND FIXTURES REQUIRED N/A.
 - 12. APPLICATION N/A.
 - 13. REFERENCES -
 - A. TM 11-5821-244-34P, ORGANIZATIONAL, DIRECT SUPPORT AND DEPOT MAINTENANCE REPAIR PARTS AND SPECIAL TOOLS LIST FOR RADIO SET AN/ARC-54, DATED 27 DEC 85.
 - B. TM 11-5821-244-34, DIRECT SUPPORT AND GENERAL SUPPORT MAINTENANCE MANUAL, RADIO SET AN/ARC-54, DATED SEP 73.
 - 14. RECORDING AND REPORTING REQUIREMENTS N/A.
 - 15. WEIGHT AND BALANCE N/A.
 - 16. POINTS OF CONTACT -
 - A. TECHNICAL POINT OF CONTACT FOR THIS MESSAGE IS MR. FRED KERSHAW, AMSAV-ECH, DSN 693-1683 OR COMMERCIAL 314/263-1683.
 - B. LOGISTICAL POINT OF CONTACT FOR THIS MESSAGE IS MS. SUE BAECHLER, AMCPM-UH-1, DSN 693-3763 OR COMMERCIAL 314/263-3763.
 - C POINT OF CONTACT FOR THIS MESSAGE IS MR. BRAD MEYER,
 - AMSAV-XSOF, DSN 693-9089 OR COMMERCIAL 314/263-9089.
 - D. FOREIGN MILITARY SALES (FMS) RECIPIENTS REQUIRING CLARIFICATION OF ACTION ADVISED BY THIS MESSAGE SHOULD CONTACT MR. RON VAN REES, AMSAV-IOA, DSN 693-2626 OR COMMERCIAL 314/263-2626. PAGE O5 RUCIFRD5424 UNCLAS
 - E. AFTER HOURS CONTACT AVSCOM COMMAND OPERATIONS CENTER (COC)
 DSN 693-2066/7 OR COMMERCIAL 314/263-2066/7.

14:14 EST

MGMCOMP