

OTUZEXH RULNNAQ3030 3230155-UUUU-RRUKMDTA  
NR UUUU

180150Z NOV 80 ZEX  
M MGR ARNG DAC (EA) APG MO //NGB-AVN-1

*Army*

*UH-1-80-  
T/R O/S  
injection*

O AIG 7401  
UVOBKA/AASF OK TULSA OK  
UHMMA/AAPA AK JUNEAU AK  
ULGCHL/AAPA ST CROIX VI CHRISTIAN STED VI

172010Z NOV 80  
M ODRTSAROOM STL MO //DRSTS-MEA(2)//  
O AIG 8001  
IG 7515

UWNSSS/US ENV PROT AGY PO BOX 15027 LAS VEGAS NV  
UECHZZ/US ENV PROT AGY REGION II 20 FEDERAL PLAZA NY NY  
UEOLMA/NATIONAL OCEANIC AND ATMOSPHERIC ADM ROCKVILLE MD  
/NOAA/AD2 COL L A WEAVER//  
NFO AIG 9004  
IG 7514

RUCLEUA/CDRUSAAYNCS FT RUCKER AL //ATZD-DI//  
RU D/USDAO TELAVIV ISRAEL  
RUFLEUA/OJUSMAG MAAG MADRID SPAIN //ARMY/NAV SEC//  
RUBHIN/AIT TAIPEI TAIWAN  
RUEHND/AIT WASH DC  
RUEVHFP/NASA KENNEDY SPACE CENTER CAPE CANAVERAL FL  
JA-BHCRVDBT

JNCLAS  
SECTION 01 OF 02  
NOTE - THIS IS A SAFETY OF FLIGHT, TECHNICAL, MESSAGE (RELEASED)

PAGE 02 RUCIFRA5906 UNCLAS  
IN ACCORDANCE WITH AR 95-18 DATED 1 MAY 1980 AND HAS NOT, REPEAT  
HAS NOT, BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES,  
ADDRESSEES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL  
SUBORDINATE UNITS, ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED,  
THE TRANSMITTAL SHALL REFERENCE THIS MESSAGE, ACTION ADDRESSEES,  
WILL IMMEDIATELY VERIFY THIS RETRANSMISSION TO ODR, TSAROOM,  
ATTN = DRSTS-MEA(1);  
SUBJ = SAFETY OF FLIGHT, TECHNICAL, MESSAGE, R09 OSGLD-1860,  
INSPECTION AND REPLACEMENT OF NUTS, TAIL ROTOR DRIVE SHAFT CLAMPS  
ON EH-1/UH-1 AND TH-1/AH-1 HELICOPTERS (AH-1-80-24, UH-1-80-10)  
A. TSAROOM SAFETY OF FLIGHT MESSAGE, AH-1-80-20, UH-1-80-20,  
TB 55-1020-243-20-4, SUBJ AS ABOVE;  
1. REF A REQUIRED REPLACEMENT OR DAILY INSPECTION OF CERTAIN  
D. REPANT SELF LOCKING NUTS (NSN 5310-20-688-2069) ON TAIL ROTOR  
DRIVE SHAFT CLAMPS DUE TO LOSS OF TORQUE;  
2. THE ITEM MANAGER, DEFENSE INDUSTRIAL SUPPLY CENTER (DISC),  
FOR NSN 5310-20-688-2069 HAS PURGED THEIR SUPPLY SYSTEM OF

CTUZEXW RULNNAQ3030 3230155-UUUU--RUMMDTA;  
NR UUUUU

180150Z NOV 80 ZEX  
M MGR ARNG OAC (EA) APG MD //NGB-AVN-1

O AIG 7401

UVORKA/AASF OK TULSA OK

UWMDMA/AAPA AK JUNEAU AK

ULGCHL/AAPA ST OROIX VI CHRISTIAN STED VI

172010Z NOV 80

M ODRTSARDQM STL MO //DRSTS-MEA(2)//

O AIG 8001

IG 7513

UWNSSS/US ENV PROT AGY PO BOX 15027 LAS VEGAS NV

UECHZZ/US ENV PROT AGY REGION 11 20 FEDERAL PLAZA NY NY

UEOLMA/NATIONAL OCEANIC AND ATMOSPHERIC ADM ROCKVILLE MD

/NOAA/AD2 COL L A WEAVER//

NFO AIG 9004

IG 7514

RUCLBUA/CDRUSAAVNGS FT RUCKER AL //ATZQ-DI//

RU D/USDAO TELAVIV ISRAEL

RUFLAFA/CDJUSMAG MAAG MADRID SPAIN //ARMY/NAV SEC//

RUBHIN/AIT TAIPEI TAIWAN

RUEHO/AIT WASH DC

RUEVHFP/NASA KENNEDY SPACE CENTER CAPE CANAVERAL FL

JA-BHCRVDBT

JNCLAS

SECTION 01 OF 02

NOTE - THIS IS A SAFETY OF FLIGHT, TECHNICAL, MESSAGE (RELEASED

PAGE 02 RUCIFRA5906 UNCLAS

IN ACCORDANCE WITH AR 95-18 DATED 1 MAY 1980) AND HAS NOT, REPEAT

HAS NOT, BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES;

ADDRESSEES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL

SUBORDINATE UNITS, ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED.

THE TRANSMITTAL SHALL REFERENCE THIS MESSAGE, ACTION ADDRESSEES.

WILL IMMEDIATELY VERIFY THIS RETRANSMISSION TO QDR, TSAROOM,

ATTN = DRSTS-MEMA(1);

SUBJ = SAFETY OF FLIGHT, TECHNICAL, MESSAGE, RGS CSGLD-1868;

INSPECTION AND REPLACEMENT OF NUTS, TAIL ROTOR DRIVE SHAFT CLAMPS

ON EH-1/UH-1 AND TH-1/AH-1 HELICOPTERS (AH-1-80-24, UH-1-80-18)

A, TSAROOM SAFETY OF FLIGHT MESSAGE, AH-1-80-24, UH-1-80-18,

TB 55-1920-243-20-4, SUBJ AS ABOVE;

1. REF A REQUIRED REPLACEMENT OR DAILY INSPECTION OF CERTAIN

D. REPANT SELF LOCKING NUTS (NSN 5310-00-668-2069) ON TAIL ROTOR

DRIVE SHAFT CLAMPS DUE TO LOSS OF TORQUE;

2. THE ITEM MANAGER, DEFENSE INDUSTRIAL SUPPLY CENTER (DISC),

FOR NSN 5310-00-668-2069 HAS PURGED THEIR SUPPLY SYSTEM OF

UH-1-80  
T/R DIS  
inspects

Army

RCTUZEXW RULNETC0759 0192108-0000--RUWMDTA;  
Z UUUUU  
R 192005Z JAN 81 ZEX  
FM MGR ARNG OAO EDGWOOD MD //NGB-AVN-L//  
TO AIG 7401  
RULGOML/TAG VI ST CROIX VI  
INFO RUCIFRA/CDRTSARCOM STL MD //DRSTS-MEM(1)//  
DA-BHOSVD

21  
ARMY  
UH-1-80-1k  
TIR DIS

BT  
UNCLAS  
SUBJ SAFETY OF FLIGHT, TECHNICAL, MESSAGE RES OSGLD-1860, INSPECTION  
AND REPLACEMENT OF NUTS, TAIL ROTOR DRIVE SHAFT CLAMPS ON EH-1/UH-1  
AND TH-1/AH-1 HELICOPTERS (AH-1-80-24, UH-1-80-16), NON-COMPLIANCE  
A, MSG TSARCOM DRSTS-MEA(2) 172010Z NOV 80 SAB,  
B, AR 95-18 AVN SAFETY-OF-FLIGHT MSG 1 MAY 80,  
C, PARA 6-6C NGR 750-1 ARMY MATERIEL AND MAINT POLICIES 21 APR 80,  
1, REF A DID NOT CONTAIN A COMPLETION DATE, FOR REPORTING PURPOSES  
THIS OFC IS ESTABLISHING 15 FEB 81 AS THE REPORTING SUSPENSE DATE,  
THE REPORT SHOULD INDICATE THAT THE INSPECTION HAS BEEN COMPLIED  
WITH OR, IF THE CORRECTIVE ACTION HAS NOT BEEN COMPLETED, THAT THE  
REQUIREMENT HAS BEEN ENTERED IN THE ACFT LOG BOOK,  
2, THIS OFC HAS NOT RECEIVED A CY OF THE COMPLIANCE ACTION FROM

AG 02 RULNETC0759 UNCLAS  
LL ARNG ACTIVITIES, THIS REPORT SHOULD BE SUBMITTED TO CDR TSARCOM  
DRSTS-MEMA AND NGB-AVN-L BY MSG PRIOR TO THE SUSPENSE DATE,  
POC FOR THIS ACTION IS MR, DON ROWES, AUTOVON 584-2027,  
8759

20 JAN 81 05 16Z

NNN

Resub to 1. 04 Nov 80

POTUZEXW RULNNAQ3030 3230155-UUUU-#RUMHDTA1

ZNR UUUUU

P 100150Z NOV 88 ZEX

FM MGR ARNG OAC (EA) APG MD //NGB-AVN-L

TO AIG 7401

RUVORKA/AASF OK TULSA OK

RUMHDMH/AAFA AK JUNEAU AK

RULGCHL/AAFA ST OROIX VI CHRISTIAN STED VI

P 172010Z NOV 88

FM ODRTSARCOM STL MO //DRSTS-MEA(2)//

TO AIG 8001

AIG 7515

RUMNSSS/US ENV PROT AGY PO BOX 15027 LAS VEGAS NV

RUBOHZZ/US ENV PROT AGY REGION II 20 FEDERAL PLAZA NY NY

RUEOLMA/NATIONAL OCEANIC AND ATMOSPHERIC ADM ROCKVILLE MD

//NOAA/AO2 COL L A WEAVER//

INFO AIG 9004

AIG 7514

RUMLEUA/CDRUSAAVNS FT RUCKER AL //ATZQ-DI//

RUMAD/USDAO TELAVIV ISRAEL

RUFLAFA/OJUSMAG MAAG MADRID SPAIN //ARMY/NAV SEC//

RUSHIN/AIT TAIPEI TAIWAN

RUEHC/AIT WASH DC

RUEVHFP/NASA KENNEDY SPACE CENTER CAPE CANAVERAL FL

DA-BHOSVDBT

UNCLAS

SECTION 01 OF 02

NOTE - THIS IS A SAFETY OF FLIGHT, TECHNICAL, MESSAGE (RELEASED

UH-80-11  
TRT

Army

PAGE 02 RUCIFRA5906 UNCLAS

IN ACCORDANCE WITH AR 95-10 DATED 1 MAY 1980) AND HAS NOT, REPEAT HAS NOT, BEEN TRANSMITTED TO UNITS SUBORDINATE TO ADDRESSEES, ADDRESSEES SHOULD IMMEDIATELY RETRANSMIT THIS MESSAGE TO ALL SUBORDINATE UNITS, ACTIVITIES OR ELEMENTS AFFECTED OR CONCERNED, THE TRANSMITTAL SHALL REFERENCE THIS MESSAGE, ACTION ADDRESSEES WILL IMMEDIATELY VERIFY THIS RETRANSMISSION TO GDR, TSARCOM,

ATTN - DRSTS-MEMA(1);

SUBJ - SAFETY OF FLIGHT, TECHNICAL, MESSAGE, RDS OBGLO-1060, INSPECTION AND REPLACEMENT OF NUTS, TAIL ROTOR DRIVE SHAFT CLAMPS ON EH-1/UH-1 AND TH-1/AH-1 HELICOPTERS (AH-1-80-24, UH-1-80-10) A, TSARCOM SAFETY OF FLIGHT MESSAGE, AH-1-80-20, UH-1-80-05, TB 55-1920-243-20-4, SUBJ AS ABOVE;

REF A REQUIRED REPLACEMENT OR DAILY INSPECTION OF CERTAIN DISCREPANT SELF LOCKING NUTS (NSN 5310-20-688-2069) ON TAIL ROTOR DRIVE SHAFT CLAMPS DUE TO LOSS OF TORQUE;

2, THE ITEM MANAGER, DEFENSE INDUSTRIAL SUPPLY CENTER (DISC), FOR NSN 5310-20-688-2069 HAS PURGED THEIR SUPPLY SYSTEM OF

DISCREPANT NUTS, HOWEVER, THERE ARE STILL DISCREPANT NUTS INSTALLED ON ARMY AIRCRAFT AND MAY STILL BE HELD IN THE ARMY SUPPLY SYSTEM.  
3. THE FOLLOWING NON-SLOTTED SELF LOCKING NUTS, NSN 5310-00-

PAGE 03 RUCIFRA5906 UNCLAS  
688-2069, HAVE BEEN AUTHORIZED FOR USE ON TAIL ROTOR DRIVE SHAFT CLAMPS IN ADDITION TO THE SLOTTED SELF LOCKING NUT, P/N 5221839-0481

A. P/N FN1216-428  
STANDARD PRESSED STEEL CO  
FSMC 80539  
NON SLOTTED SELF LOCKING NUT WITH "SRS-H19" IMPRESSED IN OUTER RADIUS ABOVE WRENCH DRIVE AREA.

B. P/N VN4298048  
VOI-SHAN CO  
FSMC 92219  
NON SLOTTED SELF LOCKING NUT WITH "VS" IMPRESSED IN RADIUS BELOW WRENCH DRIVE AREA.

4. ACTION ADDRESSEES UPON RECEIPT OF THE ABOVE PART NUMBERED NUTS SHOULD REPLACE ALL NON-SLOTTED NUTS CURRENTLY INSTALLED THAT HAVE BEEN IDENTIFIED AS DISCREPANT BY APPLICATION OF PAINT SLIPPAGE MARKS. SLIPPAGE MARKS AND DAILY INSPECTIONS ARE NOT REQUIRED AFTER REPLACEMENT IS ACCOMPLISHED. CAUTION - DO NOT INTERMIX DIFFERENT PART NUMBER NUTS ON DRIVE SHAFT CLAMPS.

BT  
#3030

NNNN

PCTUZEXH RULNNA03031 3237159-UUUU--RUKMDTA;  
ZNR UUUUU

P 160150Z NOV 80 ZEX

FM HQR ARNG DAC (EA) APG HQ //NGB-AVL-L/ *Army*

TO AIG 7481

RUVORKA/AASF OK TULSA OK

RUMMDMA/AÁFA AK JUNEAU AK

RULGOML/AÁFA ST CROIX VI CHROSTQAM STED VI

P 172010Z NOV 80

FM CDRTSARCOM STL HQ //DRSTS-MEA(2)//

TO AIG 8881

AIG 7519

RUMNSSS/US ENV PROT AGY PO BOX 15027 LAS VEGAS NV

RUEOHZZ/US ENV PROT AGY REGION II 20 FEDERAL PLAZA NY NY

RUEOLMA/NATIONAL OCEANIC AND ATMOSPHERIC ADM ROCKVILLE MD

//NOAA/A02 COL L A WEAVER//

INFO AIG 9824

AIG 7514

RUCLEUA/ODRUSAAYNCS FT RUCKER AL //ATZQ-DI//

RUCAD/USDAO TELAVIV ISRAEL

RUC-LAFA/OJUSHAG MAAG MADRID SPAIN //ARMY/NAV SEC//

RURHIN/AIT TAIPEI TAIWAN

RUEHOC/AIT WASH DC

RUEVHPP/NASA KENNEDY SPACE CENTER CAPE CANAVERAL FL

DA-BHOSVDBT

UNCLAS

FINAL SECTION OF 82

5. SERIAL NUMBER LISTING - AS SPECIFIED IN REFERENCE A.

PAGE 82 RUCIFRA5987 UNCLAS

6. DISPOSAL INSTRUCTIONS - DISCREPANT NUTS SHALL BE MUTILATED TO PREVENT FUTURE USE BY UNSUSPECTING CUSTOMER;
7. NON-DESTRUCTIVE TESTING AND INSPECTION - NOT APPLICABLE;
8. DISPOSAL OF HAZARDOUS MATERIAL - NOT APPLICABLE;
9. STATUS ACCOUNTING - ACTION ADDRESSEES UPON COMPLETION OF THE REQUIREMENT CONTAINED IN THIS MESSAGE OR NOT LATER THAN FIVE (5) DAYS AFTER ACCOMPLISHMENT, WILL FORWARD A MESSAGE REPORT OF ACTIONS ACCOMPLISHED TO COMMANDER, ISARCOM, ATTN - DRSTS-MEM IN ACCORDANCE WITH AR 95-19. THE REPORT WILL CITE THE TECHNICAL BULLETIN, THE AIRCRAFT MISSION DESIGN AND SERIES AND PERTINENT SERIAL NUMBER OF THE AIRCRAFT ON URGENT REQUIREMENT ONLY;
10. TAMMS FORMS - RECORD ACCOMPLISHMENT OF NUT REPLACEMENT IN APPLICABLE AIRCRAFT LOG BOOKS IAW PROVISIONS OF TM 38-750. THE FOLLOWING FORMS ARE APPLICABLE - DA FORM 2488-15, DA FORM 2488-15, DA FORM 2488-15;
11. FOREIGN MILITARY SALES (FMS) INTERNATIONAL LOGISTICS RECIPIENTS REQUIRING CLARIFICATION OF THIS MESSAGE SHOULD CONTACT CW3 BRUCK

CTUZEXW RULNETC0759 0192108-UUUU--RUWMDTA,  
NR UUUUU

21  
ARMY

005Z JAN 81 ZEX  
M NGR ARNG OAC EDGEWOOD MD //NGB-AVN-L//  
O AIG 7401  
ULGOML/TAG VI ST CROIX VI  
NFO RUCIFRA/CDRTSARCOM STL MO //DRSTS-MEM(1)//  
A-BHOSVD

UH  
1  
e

UNCLAS  
JBU SAFETY OF FLIGHT, TECHNICAL, MESSAGE RES CSGLD-1860, INSPECTION  
AND REPLACEMENT OF NUTS, TAIL ROTOR DRIVE SHAFT CLAMPS ON EH-1/UH-1  
AND TH-1/AH-1 HELICOPTERS (AH-1-80-24, UH-1-80-16), NON-COMPLIANCE  
MSG TSARCOM DRSTS-MEA(2) 172010Z NOV 80 SAB,  
AR 95-18 AVN SAFETY-OF-FLIGHT MSG 1 MAY 80,  
PARA 6-6C NGR 750-1 ARMY MATERIEL AND MAINT POLICIES 21 APR 80,  
REF A DID NOT CONTAIN A COMPLETION DATE, FOR REPORTING PURPOSES  
THIS OFC IS ESTABLISHING 15 FEB 81 AS THE REPORTING SUSPENSE DATE,  
C REPORT SHOULD INDICATE THAT THE INSPECTION HAS BEEN COMPLIED  
WITH OR, IF THE CORRECTIVE ACTION HAS NOT BEEN COMPLETED, THAT THE  
REQUIREMENT HAS BEEN ENTERED IN THE ACFT LOG BOOK,  
THIS OFC HAS NOT RECEIVED A COPY OF THE COMPLIANCE ACTION FROM

02 RULNETC0759 UNCLAS  
- ONG ACTIVITIES, THIS REPORT SHOULD BE SUBMITTED TO CDR TSARCOM  
ST. MEMA AND NGB-AVN-L BY MSG PRIOR TO THE SUSPENSE DATE,  
POC FOR THIS ACTION IS MR, DON BOWES, AUTOVON 584-2027,

759

20 JAN 81 05 16Z

N