




It seems this Huey Delta (UH-ID) Murphymec installed the pillow block oil reservoirs, P/N 204-010-191-1, on his bird and added the covers.

Filling the reservoirs with Mi1-L-7808 oil is a bonafide built-in maintenance check, but when Murphymec added the amber stuff, not a drop got inside one of 'em! It was installed upside down, and Murph didn't notice his booboo, which could have caused the bird to come unglued while airborne, or deadlined her just when she was needed for a Hueyvac mission.



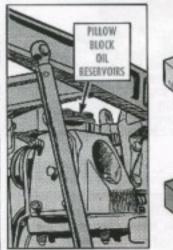



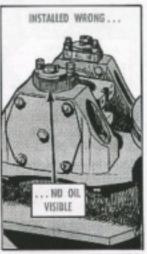

Many aircraft parts are immune to Murphy's Law. And you have checks and bythe-book maintenance to help stamp out this pest. Use 'em.