


KEEP PUMPING!

## MURPHY RIDES BOGIE WHEELS!

Any equipment deadlined for repair is a maxi-dollar caper—even if it's ground service items.

For instance, a Huey mech replaced the hydraulic pump, P/N 1730AH1G00 on the cradle of the ground handling gear—bassackwards!

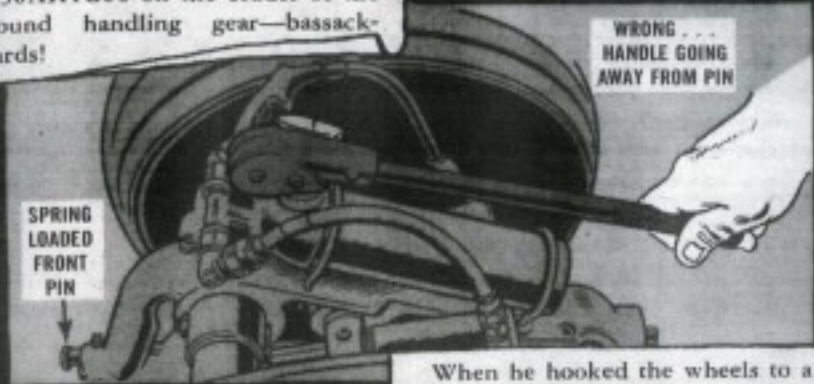

WRONG . . .  
HANDLE GOING  
AWAY FROM PIN

SPRING  
LOADED  
FRONT  
PIN

When he hooked the wheels to a Huey skid—no hydraulic pressure. He was pumping air. All the hydraulic fluid was down at the lower end of the pump.



RIGHT . . .  
HANDLE  
FACING  
PIN

Para 4-67d(2), TM 55-1520-210-20 (Sep 71) has the homework poop on replacing the pump. Figure 4-25 shows how it goes on the cradle—pump handle facing the spring loaded front pin.